

Friday, 10/13/2006 9:27:29 AM

User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: EC 135 SKIDTUBE ASSEMBLY
Job Number	: 28957	Part Number	: D135751011
Estimate Number	: 12472	Drawing Number	: D3507 REV <i>ABP/06-12-18</i>
P.O. Number	: <i>N/A</i>	Project Number	: N/A
This Issue	: 10/13/2006 S.O. No. : <i>NA</i>	Drawing Revision	: A
Prsht Rev.	: NC	Material	: <i>N/A</i>
First Issue	: <i>N/A</i> Type : LANDING GEAR	Due Date	: 11/15/2006 Qty: 1 Um: Each
Previous Run	: 28956		
Written By	: <i>JA 061013</i>		
Checked & Approved By	: <i>JA 061013</i>		
Comment	: Est Rev: A 06-06-21 New Issue JLM		

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D135-751-011 CHG001 *CZ KS 0610.23*

2.0

D2962150

3.540 Outer Tube, Extrud



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2962-150 Extrusion *B27774 DP 6-10-20*

3.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Determine square end of tube and deburr

2-Drill #30 pilot holes using DT8678. Do not open holes.

3- Deburr holes. *N/A*

4.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per program on CNC Bender and Dwg D3507. Use 5/16" locator pin on buggy "A". *N/A*

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut Fwd end of the tube using DT8185 ✓

2-Cut Aft end at VC using DT8185 ✓

3-Deburr ends ✓

4-Drill Aft & Fwd Cap holes using DT8678

5-Locate DT8870 & Drill Ground wire hole on top of Tube. ✓

6-Locate DT8870 with 3/16" cleco in Ground wire hole, then Pilot Drill all X-Bolt holes using 3/16" drill.

do not open AFT Cap holes
 7-Open Aft & Fwd Cap holes using .208" drill.

7-Drill pilot holes for wearplates using Dt8868

8-Open wearplate holes to Ø19/64" (0.297") as per Dwg D3507.

10- Bore out aft end of tube as per Dwg D3507 & Detail "B".

12- 11-Deburr holes.

open 6 AFT wearplate holes
 using DT8892 open to Ø19/64"

G-10-20

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

PH 06/10/26

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

M.E 06/10/26 ①

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Pm 06-11-①②

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D35043

CROSSBOLT SPACER



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

CROSSBOLT SPACER

Batch: B 28034

BE 06-11-02 ①

10.0

D35041

CROSSBOLT SPACER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

CROSSBOLT SPACER

Batch: B 28033

BE 06-11-02 ①

11.0

D35051

WEB



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEB

Batch: B 28962

Pm 06-11-01 ①

12.0

D35061

DOUBLER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

DOUBLER

Batch: B 28963

Pm 07-03-13 ①

13.0

D35063

DOUBLER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

DOUBLER

Batch: B 28964

Pm 07-03-13 ①

14.0

MS20601AD4W3

Rivet



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Rivet

Batch: m 8325

Pm 07-03-13 ①

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open X-Bolt holes to .375"(2Places) & .500"(2Places) as per Dwg D3507. and Detail "F" Pm 06-11-01

2-Counter Sink X-BOLT holes as per Dwg D3507 Pm 06-11-01 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description:

3-Deburr and blow out chips from inside of tube.

Pm 06-11-01 ①

4-Bond web as per Dwg D3507 & QSI 015

A/R 241 Sike Flex Batch: *m102107*

Exp Date: *07-02-01*

Pm 06-11-01 ①

5-Weld x-bolt (D3504-1/-3) spacers as per Dwg D3507 and Detail C-C & D-D.

A/R AL ROD

Batch:

m101625

BE 06-11-02 ①

6-Grind welds flush

BE 06-11-02 ①

7-Drill Rivet Holes as per Dwg D3507 Using Dt8871A&B

BE 06-11-02 ①

8-Deburr Rivet holes.

BE 06-11-02 ①

Tools: E

16.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

M09/11/06 ①

17.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Rivet D3506-1/-3 as per Dwg D3507.

Pm 07-03-13 ①

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

M07/03/13 ①

19.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

FeL 07/06/08 ①

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M-d 07/06/12 ①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/07/11
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
070612	25.0	1 D2965 cap required for ASS'y, and original w/o, the caps were powder coated black.	<i>QSI042</i>	Sand cap smooth with 320 grit, Pre-heat the D2965 cap, and powder coat white per QSI 005	<i>QSI042</i> 07/07/11	<i>EP</i> 07/07/11	<i>QSI042</i>	<i>070612</i>

NOTE: Date & initial all entries

Date: Monday, 12/18/2006 10:56:28 AM
User: Jean-Luc Menard

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

ALS71032130

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Insert

Batch: *m103495*

22.0

ALS41032225

Insert



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Insert

Batch: *m19393*

23.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Wearplate & Ground Wire inserts as per Dwg D3507.

SL 07/06/12 ①

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

M 07 06 12

25.0

D2965

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: *B28959*

①
(P70)

on previous page.

26.0

D29653

Cap



Comment: Qty.: 1.0000 (s)/Unit Total : 1.0000 (s)

Cap

Batch: *B29993*

27.0

D35081

WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch: *B51195*

SL 07/06/12 ①

Date: Monday, 12/18/2006 10:56:28 AM
User: Jean-Luc Menard

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #: Machine Or Operation: Description :

28.0 D35083 WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch: B31196

29.0 D35085 WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch: B31197

30.0 D35087 WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch: B31198

31.0 D3492041 PLUG ASSEMBLY



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

PLUG ASSEMBLY

Batch: B29983 (x2) B29797 (x2)

32.0 D3492047 PLUG ASSEMBLY



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

PLUG ASSEMBLY

Batch: B28961

33.0 AN960C10L AN960C10L Washer



Comment: Qty.: 35.0000 Each(s)/Unit Total : 35.0000 Each(s)

Washer

Batch: M103641 M104625

34.0 AN3C4A BOLT



Comment: Qty.: 31.0000 Each(s)/Unit Total : 31.0000 Each(s)

BOLT

Batch: M103641 M103641

FL 07/06/12 ①

Date: Monday, 12/18/2006 10:56:28 AM
User: Jean-Luc Menard

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

35.0	AN3C5A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: m104118

36.0	D35581	GASKET
------	--------	--------



Comment: Qty.: 1.0000 (s)/Unit Total : 1.0000 (s)

GASKET

Batch: B29998

37.0	D35583	GASKET
------	--------	--------



Comment: Qty.: 1.0000 (s)/Unit Total : 1.0000 (s)

GASKET

Batch: B29999

38.0	D35585	GASKET
------	--------	--------



Comment: Qty.: 1.0000 (s)/Unit Total : 1.0000 (s)

GASKET

Batch: B3000

39.0	D35587	GASKET
------	--------	--------



Comment: Qty.: 1.0000 (s)/Unit Total : 1.0000 (s)

GASKET

Batch: B30001

40.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign objects

2-Install Fwd & Aft caps as per Dwg D3507 And Detail "A" & "B"

A/R 241 Sika Flex Batch: m104732

Exp Date: 07/10

3-Install Wearplates as per Dwg D3507 ,seal screws with sikaflex.

Note:Install (1) srcrew and (1) washer on Ground Wire insert on top of tube

Do not Install Scews where indicated on Dwg(Note #6)

A/R 241 Sika Flex Batch: m104732

FL 07/06/26 ①

Date: Monday, 12/18/2006 10:56:28 AM
User: Jean-Luc Menard

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description :

Exp Date: 07/10

4-Install Plug assemblys as per Dwg D3507.

5- Wing Walk as per Dwg D3043 and QSI 005 4.4

FL 07/06/26 (1)

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/02/02 (4)

42.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D35121

WEARPLATE



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WEARPLATE

Batch: 031199 -X ✓

44.0

M027039108

AN3C4A.

~~Screw~~ Bolt.



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

~~Screw~~ Bolt.

Batch: 1104214 ✓

45.0

AN960JD10L

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: 1103044 ✓

07/07/09 (1)

46.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

7/7/93 (1) 0207/07/10 (1)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D135-751-011

Location:

PPP Rev:

0207/10

07/10 (1) 50

Date: Monday, 12/18/2006 10:56:28 AM
User: Jean-Luc Menard

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: EC 135 SKIDTUBE ASSEMBLY

Job Number: 28957

Part Number: D135751011

Job Number:



Seq. #:

Machine Or Operation:

Description :

48.0

QC21

FINAL INSPECTION/W/O RELEASE



①

Comment: FINAL INSPECTION/W/O RELEASE

28957

Job Completion



u 28957-11

28957

NO. 71

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name B.E.

Joint Welding Procedure TIG

Part number and Job number A135751011/B28957

TEST WELDS REQUIRED

BASE METAL Alum

WELDING PROCESS TIG

Penetration Complete ☐ Partial ☒

Single Weld ☒ Double Weld ☐

Current AC ☒ DC ☐

Backing YES ☐ NO ☒

Position

Vertical Down ☐ Up ☐

Sheet Groove

1G ☐

2G ☐

3G ☐

4G ☐

Tube Groove

1G ☐

2G ☐

5G ☐

6G ☐

Sheet Fillet

1F ☐

2F ☐

3F ☐

4F ☐

Tube Fillet

1F ☐

2F ☐

4F ☐

5F ☐

Crossbolt Spacer Welded into

Skidtube

TEST RESULTS

Visual

Pass ☒ Fail ☐

Penetration

Pass ☒ Fail ☐

Crossbolt Spacer

Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/11/02

Qualifier David Dural



DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED H	APPROVED H	DRAWING NO. D3507	REV. B SHEET 1 OF 2
DATE 06.11.01		TITLE EC 135 SKIDTUBE	SCALE NTS
A	06.04.21	NEW ISSUE	
B	06.11.01	ADD GASKET, CHANGE HARDWARE MAT'L	

RELEASED

06.12.12 H

Qty	Part Number	Description
X	D3507-041	SKIDTUBE ASSEMBLY
1	D2962-150	EXTRUSION
1	D2965	CAP
1	D2965-3 ✓	CAP
4	D3492-041 ✓	PLUG ASSEMBLY
2	D3492-047 ✓	PLUG ASSEMBLY
2	D3504-1	CROSS BOLT SPACER
1	D3504-3	CROSS BOLT SPACER
1	D3505-1	WEB
4	D3506-1	DOUBLER
2	D3506-3	DOUBLER
1	D3508-1 ✓	WEARPLATE
1	D3508-3 ✓	WEARPLATE
1	D3508-5 ✓	WEARPLATE
1	D3508-7 ✓	WEARPLATE
1	D3558-1 ✓	GASKET
1	D3558-3 ✓	GASKET
1	D3558-5 ✓	GASKET
1	D3558-7 ✓	GASKET
38	AELS-1032-130 ✓	INSERT
1	AELS-1032-225 ✓	INSERT
31	AN3C4A ✓	BOLT
4	AN3C5A ✓	BOLT
35	AN960C10L ✓	WASHER
12	MS20601AD4W3 ✓	RIVET

GENERAL NOTES:



- 1) ALL DIMENSIONS ARE IN INCHES
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) WELDING TO BE DONE PER DART QSI 004.
- 4) INSERT D3505-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- 5) USE DART DRILL TEMPLATE DT8868 TO LOCATE AND DRILL Ø0.297 HOLES (38 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION C-C (38 PLACES) AFTER FINISH. SEAL WEARPLATE SCREWS WITH SIKAFLEX-241/-291.
- 6) DO NOT INSTALL AN3C4A BOLTS AND AN960C10L WASHERS IN INDICATED LOCATIONS.
- 7) FINISH:
CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3505-1 WEB. POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3. ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4 (OPTIONAL)

Copyright © 2006 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

D3506-1 DOUBLER

D3504-1 CROSS BOLT SPACER

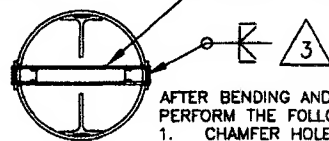
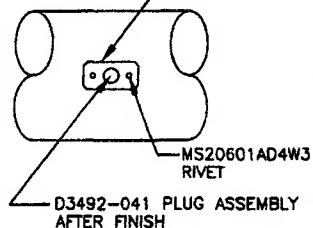


SECTION C-C
(SCALE 3:10)

- AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING FOR $\phi 0.500$ HOLES ONLY:
1. CHAMFER HOLE $0.030 \times 45^\circ$
 2. INSERT D3504-1 CROSS BOLT SPACER (2 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. IF REQUIRED, PASS $\phi 0.404$ ("Y" DRILL) THROUGH HOLE
 5. INSTALL D3506-1 DOUBLER (4 PLACES) USING MS20601AD4W3 RIVET (8 PLACES)
 6. AFTER FINISH, INSTALL D3492-041 PLUG ASSEMBLY (4 PLACES)



D3506-3 DOUBLER

D3504-3 CROSS BOLT SPACER

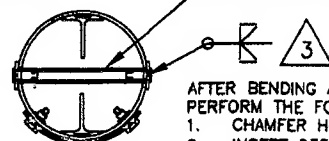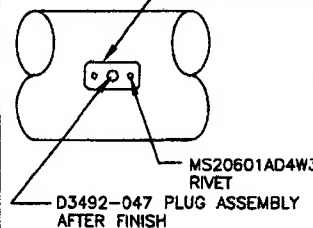


SECTION D-D
(SCALE 3:10)

- AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING FOR $\phi 0.375$ HOLES ONLY:
1. CHAMFER HOLE $0.030 \times 45^\circ$
 2. INSERT D3504-3 CROSS BOLT SPACER (1 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. IF REQUIRED, PASS $\phi 0.277$ ("J" DRILL) DRILL THRU HOLE
 5. INSTALL D3506-3 DOUBLER (2 PLACES) USING MS20601AD4W3 RIVET (4 PLACES)
 6. AFTER FINISH, INSTALL D3492-047 PLUG ASSEMBLY (2 PLACES)

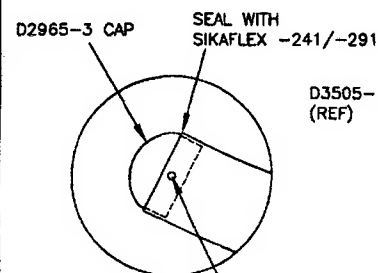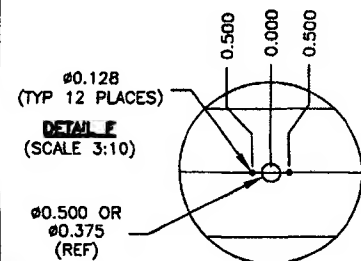


DETAIL A
(SCALE 1:5)

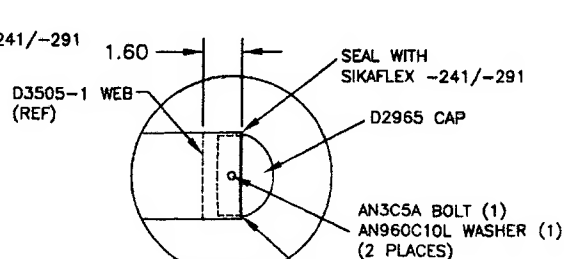


DETAIL B
(SCALE 1:5)

BORE OUT END OF SKIDTUBE TO 0.05 DEPTH AND 0.090 WALL


D3507-1 BENDING/CUTTING DETAIL

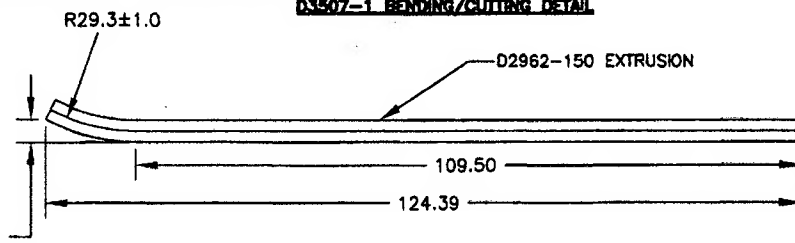

D3507-1 DRILLING DETAIL

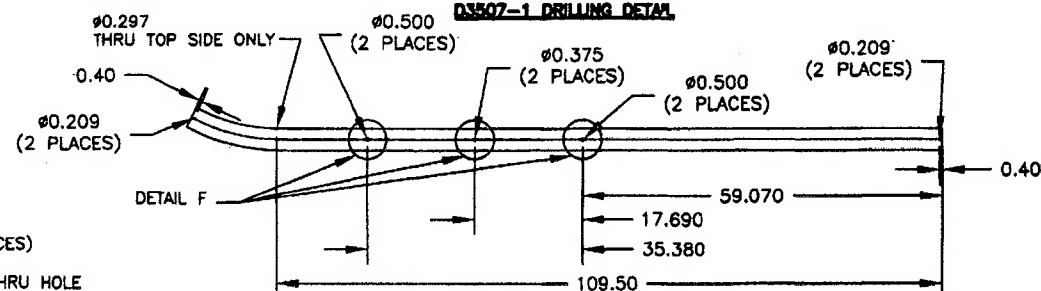


D3507-041 ASSEMBLY DETAIL

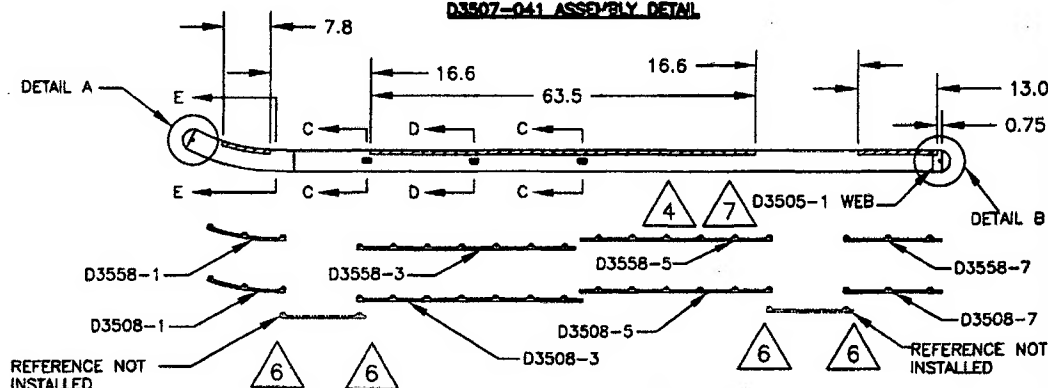

AELS-1032-130 INSERT (38 PLACES)

 AN3C4A BOLT (1)
AN960C10L WASHER (1)
(30 PLACES)



SECTION E-E
(SCALE 3:10)

RELEASED
06.12.12

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. B
CHECKED H	APPROVED H	DRAWING NO. D3507	SHEET 2 OF 2
DATE 06.11.01	TITLE EC 135 SKIDTUBE ASSEMBLY	SCALE 1:20	

DART AEROSPACE LTD		Work Order:	
Description: EC 135 SKIDPUKE		Part Number:	D3507-041
Inspection Dwg: D3507 Rev: A		Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☒ Prototype

	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
Bending	124.39	± 0.030	124.39				
	109.50	± 0.030	109.50				
	3.80 3.80	± 0.250	3.80				
Drilling	0.40	± 0.030	0.40				
	0.40	± 0.030					
	59.070	± 0.010	59.070				
	17.690	± 0.080	17.690				
	35.380	± 0.010	35.380				
	109.50	± 0.010	109.50				
Detail F	0.500	± 0.010					
Detail B	1.600	± 0.030					
	0.05	± 0.030					

Measured by:		Audited by:		Prototype Approval:	
Date:		Date:		Date:	

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	

